

KISTOCK DATALOGGER KT50 / KH50 for HVAC



Temperature / Humidity



KEY POINTS

- Configuration and data viewing software freely downloadable
- 2 configurable setpoint alarms
- Configuration and data processing software available as option
- Fast data download (1000 values/second)
- 16 000 measurement points
- Magnetic mounting
- Measure up to 2 parameters
- IP65 (KT50) and IP40 (KH50) housing

TECHNICAL FEATURES

	KT50	KH50
Units displayed	°C, °F	°C, °F, %RH
Resolution	0.1 °C, 0.1 °F	0.1 °C, 0.1 °F, 0.1%HR
External inputs	Micro USB connector	
Internal sensor	Temperature	Humidity, temperature
Setpoints alarms	2 setpoint alarms on each channel	
Frequency of measurement	From 1 min to 24 h	
Operating temperature	From -40 to +70 °C	From -20 to +70 °C
Storage temperature	From -40 to +85 °C	
Battery life	500 days*	365 days*
European directives	2004/108/EC EMC ; 2006/95/EC Low Voltage ; 2011/65/EU RoHS II ; 2012/19/EU WEEE	

HOUSING

Dimensions	60 x 40 x 21.5 mm
Weight	40 g
Display	1 line LCD screen Screen dimensions : 26.5 x 22.5 mm
Control	1 key : OK

Material
Compatible with food industry environment
ABS housing
Caps made of Elastomer

Protection rating
IP65 : KT50
IP40 : KH50

PC communication
1 micro USB input

Battery power supply
2 x CR2032 (lithium 3 V)

Environmental conditions of use
Hygrometry : from 0 to 95%HR
Maximum altitude : 2000 m
Air and neutral gases


TECHNICAL FEATURES

KT50

• INTERNAL SENSOR

Type of sensor	NTC
Measuring range	From -40 to +70 °C
Accuracy	±0.4 °C (-20 °C < T < +70 °C) ±0.8 °C (beyond)

DIMENSIONS (mm)

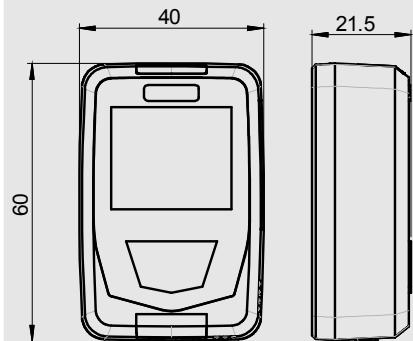

TECHNICAL FEATURES

KH50

• THERMO-HYGROMETER

Type of sensor	Hygrometry		Temperature
	CMOS		
Measuring range	From 5 to 95 %RH		From -20 to +70 °C
Accuracy*	Accuracy (Repeatability, linéarity, hysteresis) : $\pm 2\%$ HR (from 15°C to 25°C) Factory calibration uncertainty : $\pm 0.88\%$ HR Drift linked to the temperature : $\pm 0.04 \times (T-20) \%$ HR (if $T < 15^\circ\text{C}$ or $T > 25^\circ\text{C}$)		From -20 to 0°C : 2% of displayed value $\pm 0.6^\circ\text{C}$ From 0 to 30 °C : 0.5°C From 30 to 70 °C : 1.5% of displayed value
Response time ($t_{0.63}$)	50 s (Vair = 2 m/s)		25 s (V = 2 m/s)

CONNECTIONS

PC connection input



*All accuracies indicated in this document were stated in laboratory conditions and can be guaranteed for measurements carried out in the same conditions, or carried out with calibration compensation.

EN 12830 norm

KT 50 models dedicated to food industry, meet with requirements of **EN 12830 norm**. This certification is required for transportation, storage and distribution of refrigerated, frozen and deep-frozen food, and ice cream. Certification is done by an independent laboratory, **COFRAC** accredited.

RECORDER FUNCTIONS

Recording modes

The KISTOCK allows to record the values measured instantaneously, it records the values according to a predefined interval. On the other hand, it is possible to operate continuously the KISTOCK thanks to a loop recording.

3 types of dataset start

The measurement dataset can be launched :


- with a delayed start (with predefined date and time)
- with the software
- with push-button

6 types of dataset stop

You can stop your dataset :

- According to a date and time (if it was started the same way)
- According to a recording duration
- According to a predefined number of recording points
- If the storage capacity of the memory is full
- With “**Stop**” option of the software
- By holding “**OK**” key for at least 5s, if this function has been previously activated by the software.

SCREEN

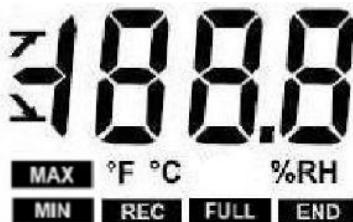

°C.. Temperature in degrees Celsius

°F.. Temperature in degrees Fahrenheit

%RH..... Relative humidity (KH 50)

END Dataset is finished

REC Records the values at the moment when this indicator appears / flashing: the dataset has not yet started

MIN Displayed values correspond to maximum and minimum values of the channels

MAX

Z Alarm action type: rising or falling action

FULL Slow flashing: dataset is taking 80-90% of storage capacity
Fast flashing: dataset is taking 90-100% of storage capacity
Constant: storage capacity filled up

BAT flashing on the screen + flashing of LEDs : means that the battery must be changed

SOFTWARE

- Freely downloadable software on www.kimo.fr/kilog
KILOGLITE software allows to configure the datalogger, to view data and to save data in pdf file.



• Configuration and data processing software

KILOG software allows you to configure, save and process your data in a very simple way.

- Only software..... Ref. KILOG-N
- Complete set : Software + 1 interface..... Ref. KIC2-N



The software is compatible with the former range of KISTOCK.

• USB cable - micro USB

This cable allows you to connect your KISTOCK to your PC.
Ref. CK50

ACCESSORIES

- Lace**. Ref. KDC
- 2 CR2032 batteries pack** . Ref. P2-50

CALIBRATION

KISTOCK dataloggers can be supplied with calibration certificate as an option.

WARRANTY PERIOD

KISTOCK dataloggers have 1-year guarantee for any manufacturing defect (return to our After-Sales Services required).

PRECAUTIONS FOR USE

Please always use the device in accordance with its intended use and within parameters described in the technical features in order not to compromise the protection ensured by the device.

MOUNTING

KISTOCK can be mounted in different ways, you can also move it or install it very easily.

- Magnetic mounting (cf. photo)
- Secured mounting



HOW TO CHANGE THE BATTERY



With 500 days* battery life, KISTOCK long-term measurements.

To change the battery :

- Unlock the battery cover with a screwdriver or a coin.
- Put the 2 batteries superimposing them (3 V CR2032 button batteries) with the + pole visible.
- Put back the batteries cover : the sign of the batteries cover must be placed in front of the opened padlock.
- Turn right the batteries cover : the sign on the batteries cover must be placed in front of the closed padlock.

* for a KT50 on the basis of 1 measurement each 15 minutes at 25 °C



CAUTION ! Material damages can occur, apply the indicated precautionary measures.



Once returned to KIMO, required waste collection will be assured in the respect of the environment in accordance with European guidelines relating to WEEE.

www.kimo.fr

Distributed by :



EXPORT DEPARTMENT

Tel : + 33. 1. 60. 06. 69. 25 - Fax : + 33. 1. 60. 06. 69. 29

e-mail : export@kimo.fr